

Scroll to next page for a printable pdf document.



For Smartphone-friendly interactive version, tap or click here.




9875/9975

VON DUPRIN®

911374-00

Mortise Exit Device Installation Instructions

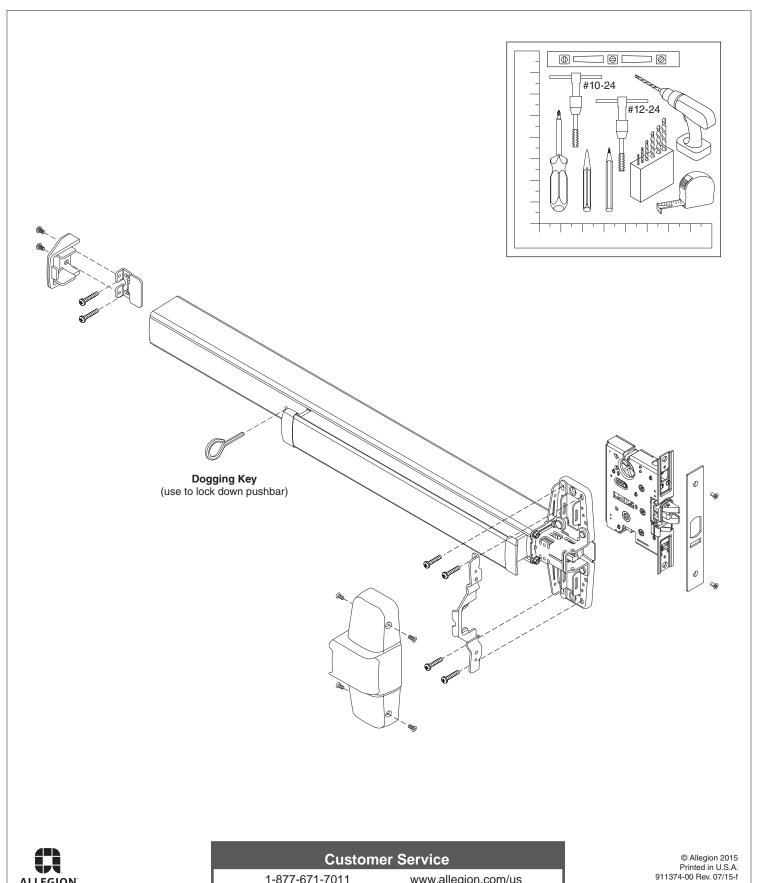





SCREW CHART

Subassembly	Screw		Application
A		#12-12 x 12-24 x 1" (25 mm) Combination	Metal or wood door
B		#10-24 x 1" (25 mm)	Surface mount or Sex bolts 13/4" (44 mm) door
		#10-24 x 1½" (38 mm)	Sex bolts, 21/4" (57 mm) door
		#10 x 11/4" (32 mm) Wood screw	Surface mount (wood)
	Packaged with 990 Trims:	#10-24 x 1%" (35 mm)	1¾" (44 mm) door, 990 Trim
		#10-24 x 1 ⁷ / ₈ " (48 mm)	21/4" (57 mm) door, 990 Trim
575 Strike Strike		#12-12 x 12-24 x 1" (25 mm) Combination	Metal or wood frame
576A Strike Strike		#12-12 x 12-24 x 1" (25 mm) Combination	Metal or wood door
D		#10-24 x ¾" (19 mm)	Surface mount or Sex bolts 13/4" (44 mm) door
		#10-24 x 11/8" (29 mm)	Sex bolts, 21/4" (57 mm) door
		#10 x 11/4" (32 mm) Wood screw	Surface mount (wood)
		#10-16 x %" (10 mm) Thread cutting	End cap
F		#8-18 x %" (10 mm) Thread cutting	Center case cover


1 Draw horizontal device center line (¢).

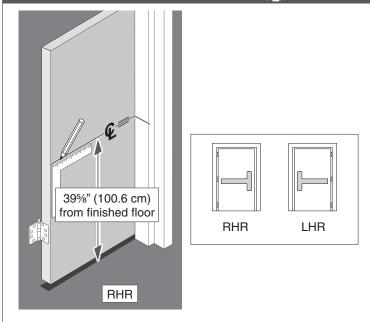

2 Position template on & and mark door.

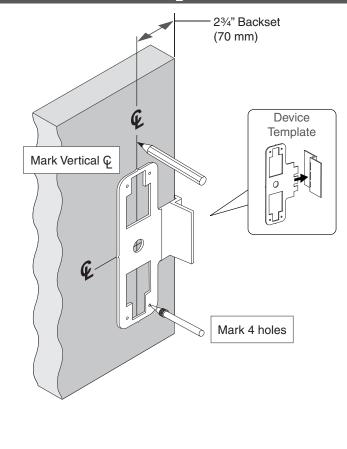



3 Locate strike center line (Ç).

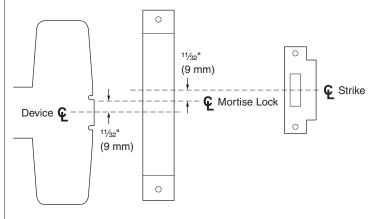

4 Prepare the door frame (or other door) for strike.


(i) 575, 575-2 strike shown. For 576A/576B strike preparation, see page 7.

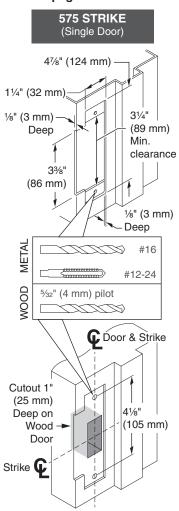

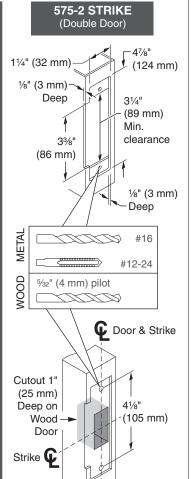


5 Install strike.

i For 576A/576B strike installation, see page 7.

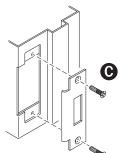


(i) See "Screw Chart" on page 2 for screw types and sizes.


6 If necessary, prepare door cutout.

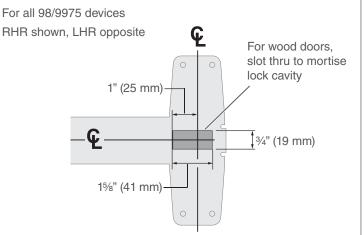


7 Prepare door for device and trim.

Prepare 4 center case mounting holes.

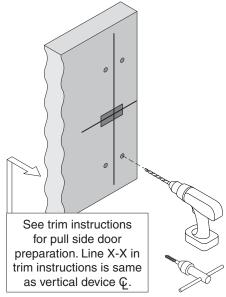


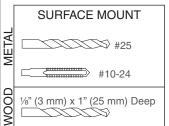

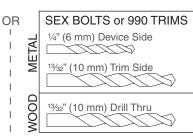

8 Install mortise lock into door.

i See 7500 mortise lock instruction #941019.

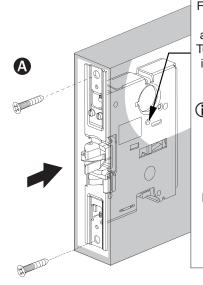


For TP, K and L trims with outside cylinder to lock and unlock trim function: Turn set screw all the way in until screw head is no longer visible.

Screw has Loctite.
It may be necessary
to run screw up and
back down a second
time.


For EO, DT, NL, E7500, and "double cylinder" applications, leave the set screw as shipped.

9 Install outside locking cylinder (if using) and complete installation of mortise lock.


i See 7500 mortise lock instruction #941019.

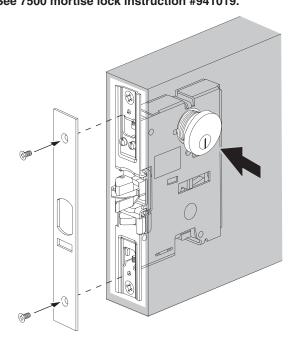

10 If necessary, cut device.

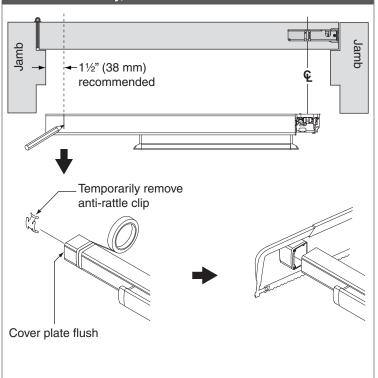



11 Install trim (if using) and attach center case to door.

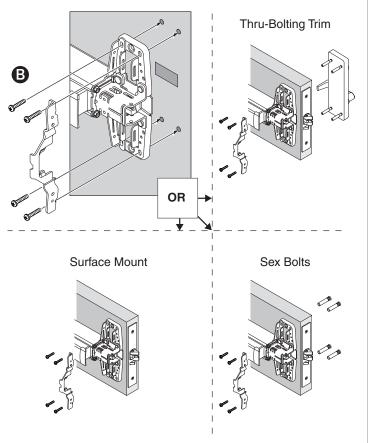



12 Mark and prepare two holes for end cap bracket.


i Prepare holes after lock side of device is mounted and hinge side is leveled.

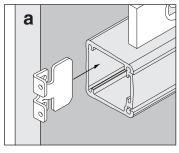

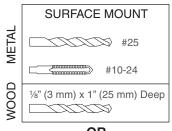


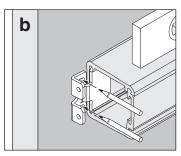

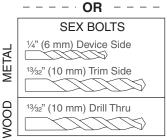

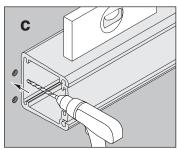


13 Install end cap bracket and end cap.

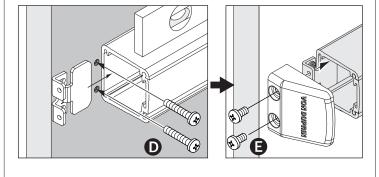


14 Adjust latch bolt.

TOP VIEW

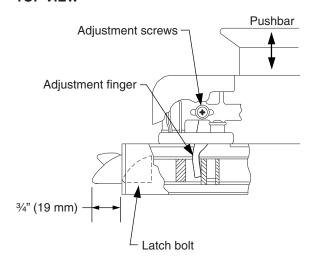

Loosen adjustment screws and adjust finger in or out until latch bolt is fully retracted (with pushbar down) and fully extended 34" (with pushbar up).


15 Install center case cover.

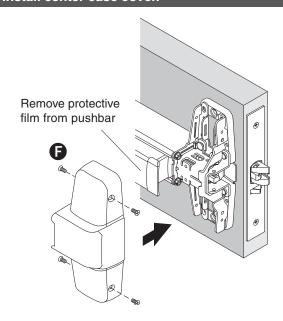


576A/576B STRIKE PREPARATION & INSTALLATION






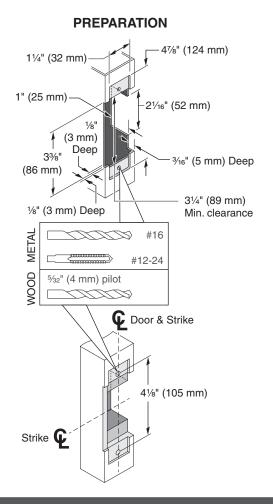


INSTALLATION

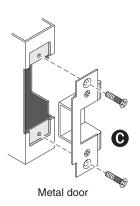


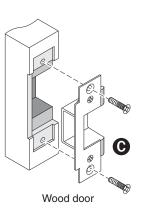



OPTIONAL EQUIPMENT


CD (Cylinder Dogging) Option

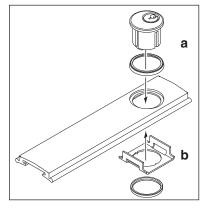

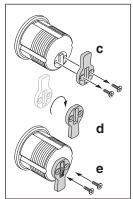

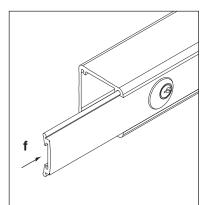


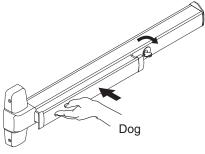


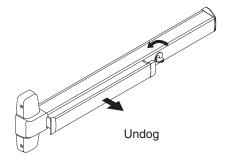


OPTIONAL EQUIPMENT (98/9975-2 DOUBLE CYLINDER)


Install Cylinder

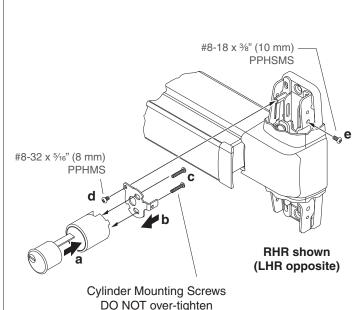

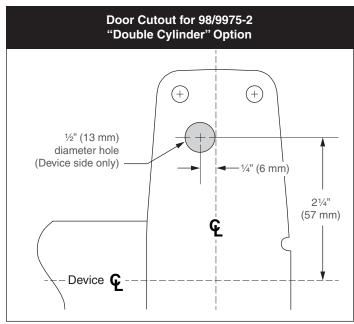

Install Cylinder Adapter Plug Assembly to Mortise Lock

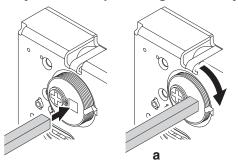


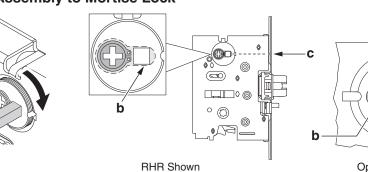

Deposite Side of Lock

- a. Screw cylinder adapter plug assembly into lock on device side using a ¼"
 (6 mm) square socket driver.
- b. Position finger as shown.
- c. Tighten cylinder screw to hold in place.

A lock/unlock label is an available option that can be used with the 98/9975-2, and is sold separately. The labels are applied above and below cylinder to match door handing.

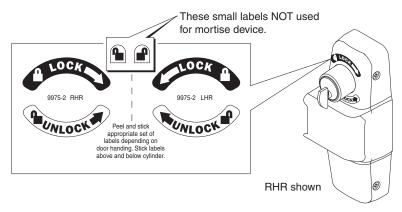

Manually affix the label:

Ensure surface is clean of dirt, dust, or oils. Clean with alcohol if necessary.

Peel the label from the paper backing and apply to the surface. Minimize handling when applying and use pressure to burnish label to surface. The adhesive will require up to 8 hours to achieve the proper bond.